



Wiring of PCD3.F121 to BCU FT1.2

Saia
PCD3.F121

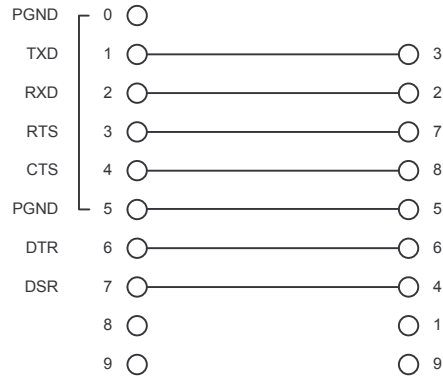

Siemens
5WG1 148-AB04

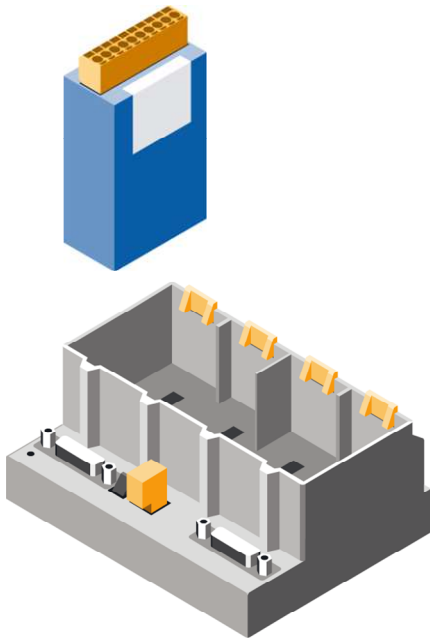

Known effects

- EIB Telegrams will be received by the PCD but the transmission is not working.
- The EIB-Group address of the BCU unit must fit to the EIB network
- DTR/DSR Lines must be connected